

Playdale Playgrounds




Post Installation Report

Swalcliffe Parish Council

Swalcliffe Play Area
Main Road , Banbury , Oxon , OX15 5EP

Risk Assessment Matrix

			Scores in the report are multiplication factors of Likelihood x Severity					
			Severity>>					
Likelihood	Very High probability, if the situation is not addressed an accident is almost certain.	5	Very High	VL (5)	L (10)	M (15)	H (20)	VH (25)
	High probability an accident is probable without any added factor.	4	High	VL (4)	L (8)	M (12)	H (16)	H (20)
	Moderate probability an incident is foreseeable.	3	Moderate	VL (3)	L (6)	L (9)	M (12)	M (15)
	Some probability, requires a combination of factors to take place.	2	Low	VL (2)	VL (4)	L (6)	L (8)	L (10)
	No significant probability; lightning strike, freak accident.	1	Very Low	VL (1)	VL (2)	VL (3)	VL (4)	VL (5)
			Very Low	Low	Moderate	High	Very High	
			1	2	3	4	5	
			No injury likely e.g. damaged or soiled clothing, minor bruising, grazes	Minor injury, laceration or bruising requiring first aid only	Injury requiring medical intervention e.g. cuts requiring stitches	Serious injury including concussions or fracture of long bones	Severe injury involving a potential life changing injury or fatality	
			Severity>>					
<p>Note 1: The total risk scores included within our reports are a multiplication factor of the calculated Likelihood and Severity of each finding. Both Likelihood and Severity are given a number between 1 - 5 as shown on the matrix above and these two numbers are then multiplied together to give the total risk score that is shown against defects on the report. Total risk scores can be divided in both directions, ie. a total risk score of 12 could be a Likelihood (3) x Severity (4) or Likelihood (4) x Severity (3).</p> <p>Note2: When we inspect we only see a snapshot of the current condition of the equipment. It is the operators responsibility to ensure that there is a continuing level of maintenance to keep the equipment in good working order and the site fit for use.</p>								

Equipment has been assessed to the following standards where relevant:

- BS EN 1176 Parts 1-11 (Playground equipment and surfacing)
- BS EN 14974 (Facilities for users of roller sports equipment)
- BS EN 15312 (Free access multi-sports equipment)
- BS EN 16899 (Parkour Equipment)
- BS EN 16630 (Outdoor Fitness Equipment).

Site Information

Inspection Ref: 751241

Site Ref: 54130

Customer Order: N/A

Inspected: 30-January-2019 - 07:59 by Chris Buss RPII Annual Inspector

Risk Assessment: L 8 Low Risk



Location:

The site is located in an area of public open space and is not directly overlooked by any properties in the local community.

Disabled Access:

Some accessible features; an area that presents difficulties to the majority of people with disabilities but in favourable circumstances and certainly in partnership can be accessed.

 3 - Very Low Risk

Item: Bench
Manufacturer: Playdale Playgrounds Ltd
Surface Type: Soil
Equipment Compliance: N/A
Surface Area Compliance: N/A



Total Findings: 1

Finding 1

This item is satisfactory - no work required -

 3 - Very Low Risk


Item: Picnic Table
Manufacturer: Playdale Playgrounds Ltd
Surface Type: Woodchip
Equipment Compliance: N/A
Surface Area Compliance: N/A



Total Findings: 1

Finding 1

This item is satisfactory - no work required -

 4 - Very Low Risk

Item: Stepping Stones
Manufacturer: Playdale Playgrounds Ltd
Surface Type: Soil
Equipment Compliance: No
Surface Area Compliance: Yes



Total Findings: 1

Finding 1

The timber edgings and top step are protruding above ground level and form hard objects within the falling space of the equipment in contravention of the requirements of BS EN 1176 Part 1 - Reinstate the surrounding surface to level with the edgings, chamfer the step end and monitor use

 4 - Very Low Risk

Item: Free Standing Slide
Manufacturer: Playdale Playgrounds Ltd
Surface Type: Bark Mulch
Equipment Compliance: Yes
Surface Area Compliance: Yes



Total Findings: 1

Finding 1

There is no identification label affixed to the equipment - Provide an identification label

8 - Low Risk

Item: 2 Bay Swing
Manufacturer: Playdale Playgrounds Ltd
Surface Type: Bark Mulch
Equipment Compliance: Yes
Surface Area Compliance: Yes



Total Findings: 1

Finding 1

The bark levels are low in one corner and are lower than the proposed finished ground level markers, this has resulted in the seats being relatively high - Top up bark levels

8 - Low Risk

Item: Site General
Manufacturer: Owner/Operator
Surface Type: N/A
Equipment Compliance: N/A
Surface Area Compliance: N/A



Total Findings: 2

Finding 1

The installation of the sign is incomplete - Complete installation and provide a sign in accordance with the recommendations set out in BS EN 1176

Finding 2

The landscaping and site clearance works are incomplete, this includes the turf around the stepping stones and benches - Complete installation and site clearance works

Findings information

4 - Very Low Risk (Finding 1)

Item: Activity Equipment - Stepping Stones
Manufacturer: Playdale Playgrounds Ltd

Risk Level: V - Very Low Risk
Surface: Soil




Finding: The timber edgings and top step are protruding above ground level and form hard objects within the falling space of the equipment in contravention of the requirements of BS EN 1176 Part 1

Action: Reinststate the surrounding surface to level with the edgings, chamfer the step end and monitor use

4 - Very Low Risk (Finding 1)

Item: Other - Free Standing Slide
Manufacturer: Playdale Playgrounds Ltd

Risk Level: V - Very Low Risk
Surface: Bark Mulch

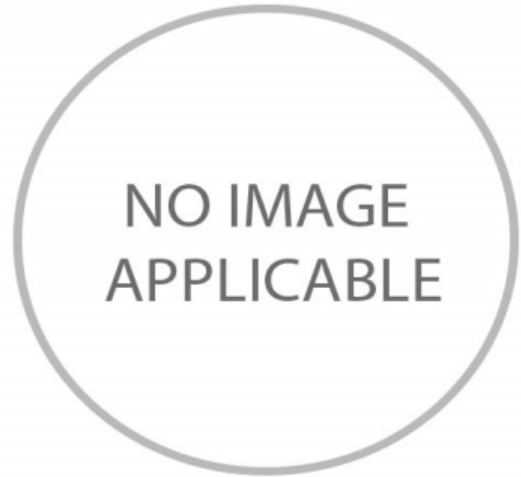

Finding: There is no identification label affixed to the equipment

Action: Provide an identification label

8 - Low Risk (Finding 1)

Item: Swings - 2 Bay Swing
Manufacturer: Playdale Playgrounds Ltd

Risk Level: L - Low Risk
Surface: Bark Mulch



Finding: The bark levels are low in one corner and are lower than the proposed finished ground level markers, this has resulted in the seats being relatively high

Action: Top up bark levels

 2 - Very Low Risk (Finding 1)

Item: Ancillary Items - Site General
Manufacturer: Owner/Operator

Risk Level: V - Very Low Risk
Surface: N/A



Finding: The installation of the sign is incomplete

Action: Complete installation and provide a sign in accordance with the recommendations set out in BS EN 1176

8 - Low Risk (Finding 2)

Item: Ancillary Items - Site General
Manufacturer: Owner/Operator

Risk Level: L - Low Risk
Surface: N/A



Finding: The landscaping and site clearance works are incomplete, this includes the turf around the stepping stones and benches

Action: Complete installation and site clearance works